


AIRCRAFT MAINTENANCE RECORDS

N 458BA

AIRFRAME LOG BOOK

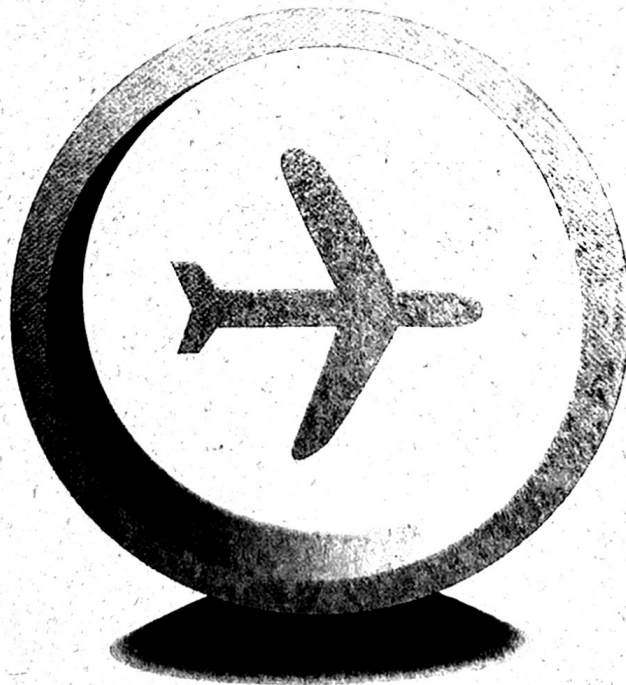

AIRCRAFT MAINTENANCE RECORDS

Owner _____

Aircraft Registration **N 458BA**

Manufacturer **Beech**

Model **95-B55**

Serial No. **TC-1830**

Position **—**

AIRCRAFT MAINTENANCE RECORD Page No. _____

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK	
Make:	Beech	 HANCOCK AVIATION <small>SALES SERVICE</small>	Reg No.: N458BA
Model:	95-B55		Date: 6/3/2022
Serial No.:	TC-1830		W/O No.: 1780
AFTT:	4315.8	AIRFRAME MAINTENANCE ENTRY	Hobbs: 4315.8

Description of Work Accomplished.

Work Completed:

- * Adjusted Glareshield and Defrost hose routing to avoid contact with control column.
- * Reinstalled 2 Missing Vortex Generators from inboard left wing and painted.
- * Jacked aircraft per MM and rigged landing gear per Maintenance Manual. Performed multiple cycles including emergency down cycle. Ops Check OK.
- * Serviced all Landing Gear Struts with Nitrogen per MM.
- * Lubricated Lower Rotating Beacon and installed new bulb P/N: **UA-7079B-24**
- * Replaced Pilot's Rosen Sunvisor Lens with new P/N: **RBB-200-1** and thumb knob kit P/N: **99-701-KIT**
- * Replaced Front Entry Door Seal with new P/N: **ADS-B127**
- * Replaced Storm Window Seal with new P/N: **ADS-B137**
- * Replaced LH & RH Landing Light Lens with new P/N: **W-2194-LH & W-2194-RH**
- * Replaced LH & RH Intake Filter Elements with new P/N: **BA-7605**
- * Installed new LH & RH Flap Bumper with new P/N: **4988**
- * Adjusted Aileron Trim tab as needed.
- * Removed LH Flap Actuator P/N: **45-521212-604** S/N: **330-A-74**. Sent to Aircraft Accessories International for overhaul. Reinstalled after Overhaul per MM. Next Due: **6615.8**
- * Removed RH Flap Actuator P/N: **45-521212-607** S/N: **363-CC-74**. Sent to Aircraft Accessories International for overhaul. Reinstalled after Overhaul per MM. Next Due: **6615.8**
- * Removed and replaced LH & RH Lower Forward Hardware with new Bolt P/N: **131790-3**, Washer P/N: **50-105011**, and Nut P/N: **EB-144**. Torqued per MM. Accomplished IAW 57-10-00. Inspection Next Due: **6/2027**. Replacement Due: **6/2032**
- * Removed and replaced LH & RH Lower Aft Hardware with new Bolt P/N: **130909B280**, Washer P/N: **95-110025-1**, Washer P/N: **MS20002-12**, and Nut P/N: **12NB126**. Torqued per MM. Accomplished IAW 57-10-00. Inspection Next Due: **6/2027**. Replacement Due: **6/2032**
- * Removed and replaced LH & RH Upper Forward Hardware with new Bolt P/N: **130909B278**, Washer P/N: **95-110021**, Washer P/N: **95-110021**, Washer P/N: **95-110021-1**, and Nut P/N: **12NB126**. Torqued per MM. Accomplished IAW 57-10-00. Inspection Next Due: **6/2027**. Replacement Due: **6/2032**
- * Removed and replaced LH & RH Upper Aft Hardware with new Bolt P/N: **130909B274**, Washer P/N: **35-105111-3**, Washer P/N: **95-110025-3**, Washer P/N: **MS20002-10**, and Nut P/N: **12NB-108**. Torqued per MM. Accomplished IAW 57-10-00. Inspection Next Due: **6/2027**. Replacement Due: **6/2032**
- * Installed new passenger window emergency exit placards P/N: **58-530258-1**
- * Installed new missing dual control arm key assembly P/N: **50-542315**
- * Replaced Exterior Decals as needed
- * Replaced all Landing Gear Cover and Boot assemblies with new
- * Replaced Upper and Lower Wing Root Seals with new. Replaced Stabilizer Root Seals with new.
- * Replaced Fuel Cap O-rings with new
- * Resealed LH & RH Brake Calipers as needed
- * Rigged Engine Controls IAW MM. Ops check OK.
- * Rebuilt Left Main Landing Gear Strut as needed and serviced per MM.
- * Installed New AeroLEDS PMA LED Taxi Light P/N: **01-1030-4587** S/N: **M23221-010**

TOTAL - CARRY FORWARD TO NEXT PAGE

AIRCRAFT MAINTENANCE RECORD

Page No. _____

Date	Total Time	DESCRIPTION OF WORK PERFORMED SIGNATURE & CERTIFICATE NUMBER OF PERSON PERFORMING WORK
------	------------	---

- Installed New AeroLEDS PMA LED Landing Lights P/Ns: 01-1030-4596 S/N: M23400-011 & M32400-016.
- Corrected wiring to right engine tach generator cannon plug
- Removed rust from right prop de-ice ring
- Tightened right alternator belt as needed
- Corrected Elevator trim tab hardware as needed
- Replaced corroded hardware throughout airframe as needed with new
- Replaced Nose Wheel Tire with new P/N: 505C66-5 S/N: 13280127. Replaced Nose Wheel Tube with new P/N: 302-013-400
- Replaced LH Main Wheel Tire with new P/N: 658C86-4 S/N: 11460074. Replaced LH Main Wheel Tube with new P/N: 092-337-0
- Replaced RH Main Wheel Tire with new P/N: 658C86-4 S/N: 11460010. Replaced RH Main Wheel Tube with new P/N: 092-337-0
- Replaced Main Ship Batteries with new P/N: G-25 S/Ns: G03151894 & G03151900
- Replaced Nose Wheel Tow Pin with new P/N: 60-820029-1
- Replaced Instrument Air Filters with new P/N: RAD9-18-1 & RAB3-5-1

Inspections Completed:

- Completed Annual Inspection IAW Beechcraft Baron Maintenance Manual, and current FARs.
- C/W ELT Operational Check IAW FAR 91.207d. Battery Due: May 2024
- C/W AD 91-17-01 Elevator Trim Tab Actuators IAW Beech Service Bulletin 2399. No Further Action Required.
- C/W AD 76-07-12 Bendix Switch Repair or Replacement IAW Bendix SB 583. No Defects Noted. Next Due: 4415.8
- C/W AD 04-25-16 R1 B-Series Combustion Heaters – Fuel Regulator Shutoff Valve IAW Kelly Service Bulletin A-107A. No Fuel Leak Noted. Next Inspection Due: 4415.8 or 6/3/2023, whichever occurs first.
- C/W AD 04-21-05 B-Series Combustion Heaters – Air Pressure Switch. PDT Passed. Next Due: 860.4 Heater Hobbs or 6/3/2024, whichever occurs first.

Approval for Return to Service

The article identified above was repaired and inspected in accordance with current FAA regulations and was found to be airworthy and is approved for return to service. Pertinent details of the work performed are on file at this agency under this work order.

Joseph B. Averett

Authorized Signature Joseph B Averett 2740243 IA/AP

Hancock Aviation LLC
4409 Chuck Yeager Avenue
Baton Rouge, LA 70807

Phone: (225) 800-2359 Fax: (225) 224-6211
Email: info@hancockaviation.com
Web: www.hancockaviation.com

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE

AURIC AVIONICS & INSTRUMENTS

FAA CRS # UAWR246L

6109 G. Bellanca Street
Lakefront Airport – Bastian-Mitchell Hangar
New Orleans, LA 70126
(504) 245-0072

10/17/2022
N458BA
Beech 95-B55 S/N TC-1830
Work Order(s): 18037

Removed the existing 300-14EL Standby Electric ADI, NSD360 Compass System, WX900 Stormscope Display and A30 Encoder. Installed a new Garmin 5 EADI S/N 4JQ066889, G5 EHSI S/N 4JQ064920, GMU11 Magnetometer S/N 56J109779 and GAD29D Adapter S/N 6V9503510. Rewired and corrected Autopilot interface. Corrected Nav 2 wiring and rewired Transponder to accept Air Data. Configured, calibrated and tested all systems as required. Leak tested pitot/static system. All ops ground checked nominal after installation. Submitted FAA Form 337 and updated aircraft records. Aircraft approved for return to service with respect to work performed in the above listed Work Order(s).

NEW EW 3500.52
NEW UL 1599.48
NEW CG 77.88

Victor Schilleci, IV
Victor Schilleci, IV
FAA-CRS# UAWR246L
AuricAvionics@aol.com

Make:	Beech	 HANCOCK AVIATION SALES • SERVICE	Reg No.:	N458BA
Model:	95-B55		Date:	11/2/2022
Serial No.:	TC-1830		W/O No.:	1901
AFTT:	4371.2	AIRFRAME MAINTENANCE ENTRY	Hobbs:	4371.2

Description of Work Accomplished.

Work Completed:

- Adjusted Cabin Door and installed new hardware as needed to obtain a better fit.
- Performed Touch Up Painting on leading edges and fairings.
- Installed Overhauled Right Engine Tach Generator P/N: 96-389000 S/N: 2547. Repaired cannon plug wiring. Ops Check OK.

Approval for Return to Service

The article identified above was repaired and inspected in accordance with current FAA regulations and was found to be airworthy and is approved for return to service. Pertinent details of the work performed are on file at this agency under this work order.

Joseph B. Averett

Authorized Signature Joseph B Averett 2740243 IA/AP

Hancock Aviation LLC
4409 Chuck Yeager Avenue
Baton Rouge, LA 70807

Phone: (225) 800-2359 Fax: (225) 224-6211
Email: info@hancockaviation.com
Web: www.hancockaviation.com

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE

Make:	Beech	 HANCOCK AVIATION <small>SALES SERVICE</small>	Reg No.:	N458BA
Model:	95-B55		Date:	3/17/2023
Serial No.:	TC-1830		W/O No.:	2016
AFTT:	4390.5		Hobbs:	4390.5
AIRFRAME MAINTENANCE ENTRY				

Description of Work Accomplished.


Work Completed:

- * Replaced Instrument Lighting Transistors with new P/N: 2N3055
- * Installed 5th & 6th seats and updated W&B as needed.
- * Repaired Autopilot system wiring as needed and NexGen Avionics installed serviceable flight director computer. Ops Check OK.

Approval for Return to Service

The article identified above was repaired and inspected in accordance with current FAA regulations and was found to be airworthy and is approved for return to service. Pertinent details of the work performed are on file at this agency under this work order.

Authorized Signature

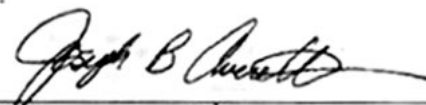

Joseph B Averett 2740243 IA/AP

Hancock Aviation LLC
4409 Chuck Yeager Avenue
Baton Rouge, LA 70807

Phone: (225) 800-2359 Fax: (225) 224-6211
Email: info@hancockaviation.com
Web: www.hancockaviation.com

Make:	Beech	 HANCOCK AVIATION <small>SALES SERVICE</small>	Reg No.:	N458BA
Model:	95-B55		Date:	3/31/2023
Serial No.:	TC-1830		W/O No.:	2022
AFTT:	4390.5		Hobbs:	4390.5
AIRFRAME MAINTENANCE ENTRY				

Description of Work Accomplished.

Work Completed:

- * Installed two new middle passenger seats lap belt assemblies P/N: 2023-1-031-8120 provided by AmSafe, Inc.
- * Provided customer with two lap belt extender assemblies P/N: 1027-1-011-8120.

Approval for Return to Service

The article identified above was repaired and inspected in accordance with current FAA regulations and was found to be airworthy and is approved for return to service. Pertinent details of the work performed are on file at this agency under this work order.

Authorized Signature



Joseph B Averett 2740243 IA/AP

Hancock Aviation LLC
4409 Chuck Yeager Avenue
Baton Rouge, LA 70807

Phone: (225) 800-2359 Fax: (225) 224-6211
Email: info@hancockaviation.com
Web: www.hancockaviation.com

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE

Make:	Beech	 HANCOCK AVIATION <small>SALES SERVICE</small>	Reg No.:	N458BA
Model:	95-B55		Date:	7/14/2023
Serial No.:	TC-1830		W/O No.:	2135
AFTT:	4421.0		Hobbs:	4421.0
AIRFRAME MAINTENANCE ENTRY				

Description of Work Accomplished.

Work Completed:

- * Removed LH & RH Optional Prop Accumulator Systems. Capped lines as needed
- * Replaced LH & RH Engine Air/Oil Separator Return Hoses with new P/N: 193-8
- * Installed new Vacuum System Filters P/Ns: D9-18-1 & ARB3-5-1
- * Replaced Right Engine Oil Temp Resistance Bulb with new P/N: MS28034-1 S/N: 325242
- * Replaced Nose Wheel Bearings with new P/N: 08125-20629
- * Replaced Air Filter Elements with new P/N: BA-7605
- * Stop-drilled cracks in Tail Position Light & LH Position Light Lenses
- * Serviced Aircraft Batteries as needed
- * Replaced LH & RH Brake Linings with new P/Ns: RA66-44 using Brake Pins P/Ns: RA177-00300. Resealed Brake Calipers with new O-Rings and serviced Brake System


Inspections Completed:

- * Completed Annual Inspection IAW Beechcraft Baron Series Maintenance Manual and current FARs
- * C/W ELT Operational Check IAW FAR 91.207d. ELT Battery Due: 05/2024
- * C/W AD 04-21-05 B-Series Combustion Heaters – Air Pressure Switch IAW (e)(1) & Janitrol Service Bulletin # A-103. PDT Passed. Next Inspection due: 7/14/2025 or 874.6 Heater Hours, whichever occurs first.
- * C/W AD 04-25-16 R1 B-Series Combustion Heaters – Fuel Regulator Shutoff Valve IAW Kelly Aerospace Service Bulletin A-107A. No Leaks Found. Next Inspection due: 7/14/2024 or 4521.0 AFTT, whichever occurs first.
- * C/W AD 76-07-12 Switch Repair or Replacement. No Fault Found. Next Inspection due 4521.0 AFTT.

Approval for Return to Service

The article identified above was repaired and inspected in accordance with current FAA regulations and was found to be airworthy and is approved for return to service. Pertinent details of the work performed are on file at this agency under this work order.

Authorized Signature

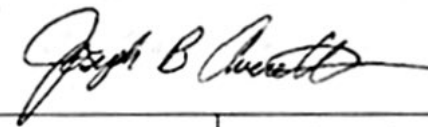

Joseph B Averett 2740243 IA/AP

Hancock Aviation LLC
4409 Chuck Yeager Avenue
Baton Rouge, LA 70807

Phone: (225) 800-2359 Fax: (225) 224-6211
Email: info@hancockaviation.com
Web: www.hancockaviation.com

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO NEXT PAGE

